

# Instructions Preformed Clamps

Apply with the **Bandimex Tool W001** and **Bandimex Adapter V001 (a)** or **V050 (b)**.


Place Bandimex Tool in vise, put Bandimex Adapter on nose of tool. Slip Preformed Clamp in tool and grip tail end with excenter lever.

Insert hose into clamp and apply tension. To control tensioning, hold thumb on that side of buckle where band enters. When band stops moving through buckle, maximum tension has been applied.

Roll hose over until shear hook engages behind buckle edge, at the same time reversing handle by  $\frac{1}{4}$  to  $\frac{1}{2}$  turn (depending on type and size of hose).

**(a)**  
Pull on cutter lever to cut band.

**(b)**  
Turn disc by hand until tight. Put ratchet wrench on hex nut and operate until band is sheared off.

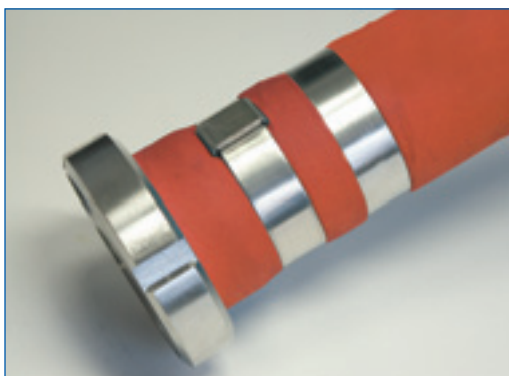

◀ The finished Bandimex Preformed Clamp requires no hammering or crimping.

